Instruccions calibratge balança KERN EW/EG-N

Adjustment procedure:
Check that the surrounding conditions are stable.
A short warm-up time of about 10 minutes is recommended for stabilisation.

Operation	Display
Switch-on balance with button ⏻, after a short time [***S.A. CAL***] will appear.	***S.A. CAL***
Press buttons F and TARE at the same time and release at the same time, [***WAit***] is briefly displayed. After that [***CAL.0***] will appear flashing, Zero point will be saved. After that [***CAL.on***] will appear.	CAL ***WAit*** ⇩ CAL ***CAL. 0*** ⇩ CAL ***CAL. on*** ⇩
Rotate the turn knob on the right side of the balance in to position **CAL**. 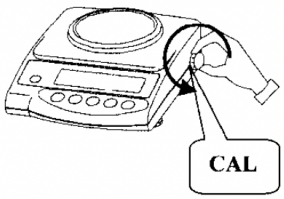 Adjustment is carried out automatically. [***CAL.on***] will appear flashing.	CAL ***CAL. on***
The display changes automatically from [***CAL.on***] to [***CAL.oFF***] The process of adjustment is completed.	CAL ***CAL. oFF***
Turn the adjusting knob on the right side of the balance to the **WEIGH** position. 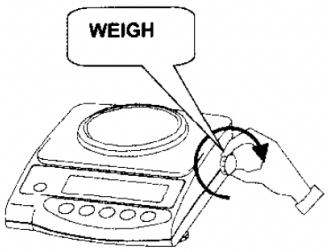 Calibration is now finalised. The balance will automatically return to weighing mode.	CAL ***buSY*** ⇩ ***End.***